

# **INDUSTRIAL PLASMA CUTTING EQUIPMENT**

esab.com



# **TABLE OF CONTENTS**

PLASMA SYSTEMS  Cutmaster 42  Cutmaster 52  Cutmaster 82  Cutmaster 102  Cutmaster 152  Cutmaster Range Selection Guide.  Aircut 15C  Drag-Gun Plus	
PLASMA TORCHES  1Torch SL60.  1Torch SL100.  SL100 Mechanized.  SL100SV Automation.  Torch Connection Guide  Adapter Kits.  Consumables.	10
PLASMA ACCESSORIES Cutting Guides Lead Covers Pendants. Lead Extensions Air Filter Kits Carts Automation Accessories	14
PAK 200i	







Dr. James Browning, Founder









1.37 I Janes Howing & Maries Trope

Drough The man Drawics Trope

Tal De Unit Condined into the Unit.

TAN AA INCORPORATE AND CORPORATE TO CHINETE. , 30 dinde place hachine current.

ON 15 distance of the light of

Postus donaire introduced.

To ak Marte of A series and the dot adith Associated of the discontinues of the season of the state of the season of the season

# AT THE FOREFRONT OF PLASMA CUTTING INNOVATION





# **CUTMASTER® TRUE™ SERIES**

# PLASMA CUTTING SYSTEMS

Cutmaster TRUE™ Series has been designed with the idea that recommended cut capacity should also be the TRUE cut capacity. The TRUE Cut Series eliminates the concept of having to "buy up", purchasing a machine larger than you actually need.

With the introduction of the Cutmaster TRUE Series, a one-half inch recommended capacity machine will cut one-half inch material ALL DAY, EVERY DAY. NO EXCEPTIONS.



#### TRUTH #1

■ True Confidence - The Cutmaster® TRUE™ Series microprocessor controlled front panel LED's assure extreme operator confidence and error free use from setup to clean up.\*

#### TRUTH #2

True Strength -The Cutmaster TRUE Series allows you to work all day at our recommended cut capacity. But when you need that extra punch, you can be confident that it's there.

#### TRUTH #3

■ True Protection - As if a 4 year unlimited power supply warranty wasn't enough, the Cutmaster TRUE Series is the only line of plasma cutting machines that features TRUE GUARD™ – a rugged roll bar for added durability on our larger plasma systems.\*

#### TRUTH #4

■ True Tip<sup>TM</sup> - The Victor Thermal Dynamics Cutmaster TRUE Series plasma system offers the only 60 Amp drag cutting tip on the market today.\*

#### **TRUTH #5**

■ True Flexibility - The multi-voltage Cutmaster TRUE Series features the versatile and patented 1Torch® with SureLok® technology and consumable parts, lead extensions which provide cutting up to 100¹ (30.5 m) from power supply, and the flexibility to move quickly from hand to mechanized cutting all with the change of a Torch. (Add PCB for CNC interface.)\*

#### TRUTH #6

- True Portability The Cutmaster TRUE Series offers lighter, more portable machines without compromising performance.
- \* Not available on the CUTMASTER 42

# **CUTMASTER 42**

#### LIGHT DUTY

The Cutmaster 42 is one of the most affordable, highest quality 120V 1/4" (6 mm) plasma systems on the market. At 230V, the Cutmaster 42 delivers 40A, a recommended cut of 3/8". As part of the TRUE Series, you can rely on the Cutmaster 42 to cut all day at its recommended cutting capacity and to pack more punch when you need it. The Cutmaster 42 incorporates Vent2Shield (V2S) technology allowing the use of a considerably smaller compressor (less weight to carry, can be used with 120V) compared to similar 40A units.

- Auto body / marine repair
- Plumbing & HVAC
- Home shop
- Metal building & roofing construction
- Rental fleets
- 4-Year Warranty power supply
- 1-Year warranty torch



#### **PERFORMANCE**

- Maximum Cut -5/8" (15 mm) @ 120V, 7/8" (22.2 mm) @ 230V
- Recommended Cut -1/4" (6 mm) @ 120V, 3/8" (9.5 mm) @ 230V
- Pierce Rating -1/4" (6 mm) @ 120V, 3/8" (9.5 mm) @ 230V
- Max Amperage Output -27A @ 120V, 40A @ 230V
- Output Power 3.8 kW

# **DIMENSIONS**

■ 7" W x 9" H x 18.5" D (177 mm x 228 mm x 470 mm)

#### WEIGHT

■ 26 lbs (11.8 kg)

# **TORCH**

- SL40
- Air Pressure 75 psi (5.2 bar)
- 3.2 cfm (91 l/m)

#### **INPUT VOLTAGE**

■ 120/230V, 1 ph, 50/60 Hz

# DUTY CYCLE (@ 40° C)

■ 40% @ 40A @ 230V

# **AMPERAGE DRAW**

- 29A @ 120V
- 15A @ 230V

Part No.	Torch	Input Voltage
1-4200	SL40 <sup>™</sup> 75° hand torch 15 ft (4.5 m) lead	120/230V 1 Phase
1-4200-7 (CSA)	SL40 75° hand torch 15 ft (4.5 m) lead	120/230V 1 Phase
7-0040	SL40 w/ATC, 75° hand torch 15 ft (4.5 m) lead	

#### **SL40 CONSUMABLES**



# **CUTMASTER 52**

# **MEDIUM DUTY**

The Cutmaster 52 is the most powerful 1/2" (12 mm) machine on the market today. This unit cuts through mild, stainless, or aluminum up to 1 1/8" (30 mm) thick. The Cutmaster 52 combines power with the well known performance and features of the industry-leading 1Torch\*.

- Construction
- Maintenance
- Repair
- Fabrication
- 4-Year warranty power supply
- 1-Year warranty torch



# **CUTMASTER82**

# MEDIUM/HEAVY DUTY

The Cutmaster 82 weighs in at a mere 43 lbs (19.5 kg) while still offering superior cutting power. Don't let the size of this unit fool you, it's more than capable of cutting 3/4" (20 mm) with a maximum capability of 1 1/2" (40 mm). This unit, like all other TRUE" Cutmasters, is equipped with the 1Torch\*.

- Heavy fabrication
- Manufacturing
- Contractors
- 4-Year warranty power supply
- 1-Year warranty torch



# **PERFORMANCE**

- Maximum Cut 1 1/8" (30 mm)
- Recommended Cut 1/2" (12 mm)
- Pierce Rating 1/2" (12 mm)
- Max Amperage Output 60A
- Output Power 6.2 kW

# **DIMENSIONS**

■ 12" W x 15" H x 24" D (305 mm x 381 mm x 610 mm)

#### **WEIGHT**

43 lbs (19.5 kg)

### **TORCH**

- SL60
- Air Pressure 75 psi (5.2 bar)
- 6.7 cfm (190 l/m)

# **INPUT VOLTAGE**

- 208-230/460V, 1/3 ph, 50/60 Hz
- 400V, 3 ph, 50 Hz
- 600V, 3 ph, 50/60 Hz

#### DUTY CYCLE (@ 40° C)

- 40% @ 60A
- 60% @ 50A
- 100% @ 30A

# **AMPERAGE DRAW**

- 45A @ 230V, 1 ph
- 24A @ 230V, 3 ph
- 16A @ 460V, 3 ph

# **PERFORMANCE**

- Maximum Cut 1 1/2" (40 mm)
- Recommended Cut 3/4" (20 mm)
- Pierce Rating 5/8" (15 mm)
- Max Amperage Output 80A
- Output Power 9 kW

# **DIMENSIONS**

■ 12" W x 15" H x 24" D (305 mm x 381 mm x 610 mm)

#### **WEIGHT**

43 lbs (19.5 kg)

### **TORCH**

■ SL60

5

- Air Pressure 70 psi (4.8 bar)
- = 6.7 cfm (190 l/m)

#### **INPUT VOLTAGE**

- 208-230/460V, 1/3 ph, 50/60 Hz
- 400V, 3 ph, 50 Hz
- 600V, 3 ph, 50/60 Hz

#### DUTY CYCLE (@ 40° C)

- 40% @ 80A
- 60% @ 65A
- 100% @ 55A

# **AMPERAGE DRAW**

- 72A @ 230V, 1 ph
- 39A @ 230V, 3 ph
- 21A @ 460V, 3 ph

Part No.	Torch	Configured Input Voltage
1-5130-1	SL60° 75° hand torch 20 ft (6.1 m) lead	208-230V, 1 Phase
1-5130-2	SL60 75° hand torch 20 ft (6.1 m) lead	460V, 3 Phase
1-5130-5	SL60 75° hand torch 20 ft (6.1 m) lead	600V, 3 Phase
1-5131-1	SL60 75° hand torch 50 ft (15.2 m) lead	208-230V, 1 Phase
1-5131-2	SL60 75° hand torch 50 ft (15.2 m) lead	460V, 3 Phase
1-5131-5	SL60 75° hand torch 50 ft (15.2 m) lead	600V, 3 Phase

Cutmaster Systems include: Power supply, torch, spare parts kit, input power cable, work cable and clamp, and an instructional DVD.

See pages 14-15 for accessories and page 13 for torch consumable parts.

Part No.	Torch	Configured Input Voltage
1-1130-1	SL60° 75° hand torch 20 ft (6.1 m) lead	208-230V, 1 Phase
1-1130-2	SL60 75° hand torch 20 ft (6.1 m) lead	460V, 3 Phase
1-1130-5	SL60 75° hand torch 20 ft (6.1 m) lead	600V, 3 Phase
1-1131-1	SL60 75° hand torch 50 ft (15.2 m) lead	208-230V, 1 Phase
1-1131-2	SL60 75° hand torch 50 ft (15.2 m) lead	460V, 3 Phase
1-1131-5	SL60 75° hand torch 50 ft (15.2 m) lead	600V, 3 Phase

Cutmaster Systems include: Power supply, torch, spare parts kit, input power cable, work cable and clamp, and an instructional DVD.

See pages 14-15 for accessories and page 13 for torch consumable parts.



# **CUTMASTER 102**

# **HEAVY DUTY**

The Cutmaster 102 weighs in at 62 lbs and provides 100 amps of cutting power. This unit's light weight compact design combined with multiple voltage selection makes it the most portable and powerful cutting machine available. This unit combined with the 1Torch® has a maximum cut capacity of 1 3/4" (45 mm). More cut capacity than any other system in its class!

- Heavy fabrication
- Manufacturing
- 4-Year warranty power supply
- 1-Year warranty torch



# **CUTMASTER 152**

# EXTRA HEAVY DUTY

The Cutmaster 152, weighing only 62 lbs, offers multi-voltage 1-or 3-phase input capability and provides 120 amps of cutting power for a 1 1/4" (30 mm) recommended cut and 2" (50 mm) maximum cut. This compact unit, like all other Cutmasters, comes standard with the 1Torch® providing you with the well known comfort and reliability famous throughout the industry.

- Heavy fabrication
- Manufacturing
- 4-Year warranty power supply
- 1-Year warranty torch



#### **PERFORMANCE**

- Maximum Cut 1 3/4" (45 mm)
- Recommended Cut 1" (25 mm)
- Pierce Rating 3/4" (20 mm)
- Max Amperage Output 100A
- Output Power 12 kW

# **DIMENSIONS**

■ 12" W x 15" H x 30" D (305 mm x 381 mm x 762 mm)

#### **WEIGHT**

■ 62 lbs (28.1 kg)

#### **TORCH**

- SL100
- Air Pressure 70 psi (4.8 bar)
- 7.5 cfm (212 l/m)

#### **INPUT VOLTAGE**

- 208-230/460V, 1/3 ph, 50/60 Hz
- 400V, 3 ph, 50 Hz
- 600V, 3 ph, 50/60 Hz

# DUTY CYCLE (@ 40° C)

- 60% @ 100A
- 80% @ 80A
- 100% @ 70A

# AMPERAGE DRAW

- 95A @ 230V, 1 ph
- 45A @ 230V, 3 ph
- 29A @ 460V, 3 ph

#### **PERFORMANCE**

- Maximum Cut 2" (50 mm)
- Recommended Cut 1 1/4" (30 mm)
- Pierce Rating 1" (25 mm)
- Max Amperage Output 120A
- Output Power 15.4 kW

# **DIMENSIONS**

■ 12" W x 15" H x 30" D (305 mm x 381 mm x 762 mm)

#### **WEIGHT**

■ 62 lbs (28.1 kg)

# TORCH

- SL100
- Air Pressure 70 psi (4.8 bar)
- 7.5 cfm (212 l/m)

#### **INPUT VOLTAGE**

- 208-230/460V, 1/3 ph, 50/60 Hz
- 400V, 3 ph, 50 Hz
- 600V, 3 ph, 50/60 Hz

### DUTY CYCLE (@ 40° C)

- 80% @ 120A
- 100% @ 100A

# **AMPERAGE DRAW**

- 120A @ 230V, 1 ph
- 56A @ 230V, 3 ph
- 37A @ 460V, 3 ph

Part No.	Torch	Input Voltage
1-1330-1	SL100° 75° hand torch 20 ft (6.1 m) lead	208-230V, 1 Phase
1-1330-2	SL100 75° hand torch 20 ft (6.1 m) lead	460V, 3 Phase
1-1330-5	SL100 75° hand torch 20 ft (6.1 m) lead	600V, 3 Phase
1-1331-1	SL100 75° hand torch 50 ft (15.2 m) lead	208-230V, 1 Phase
1-1331-2	SL100 75° hand torch 50 ft (15.2 m) lead	460V, 3 Phase
1-1331-5	SL100 75° hand torch 50 ft (15.2 m) lead	600V, 3 Phase

Cutmaster Systems include: Power supply, torch, spare parts kit, input power cable, work cable and clamp, and an instructional DVD.

See pages 14-15 for accessories and page 13 for torch consumable parts.

Part No.	Torch	Input Voltage
1-1730-1	SL100° 75° hand torch 20 ft (6.1 m) lead	208-230V, 1 Phase
1-1730-2	SL100 75° hand torch 20 ft (6.1 m) lead	460V, 3 Phase
1-1730-5	SL100 75° hand torch 20 ft (6.1 m) lead	600V, 3 Phase
1-1731-1	SL100 75° hand torch 50 ft (15.2 m) lead	208-230V, 1 Phase
1-1731-2	SL100 75° hand torch 50 ft (15.2 m) lead	460V, 3 Phase
1-1731-5	SL100 75° hand torch 50 ft (15.2 m) lead	600V, 3 Phase

Cutmaster Systems include: Power supply, torch, spare parts kit, input power cable, work cable and clamp, and an instructional DVD.

See pages 14-15 for accessories and page 13 for torch consumable parts.

# **CUTMASTER TRUE SERIES SELECTION GUIDE**











**CUTMASTER 42** 

**CUTMASTER 52** 

**CUTMASTER 82** 

**CUTMASTER 102** 

**CUTMASTER 152** 

# CUTMASTER TRUE SERIES SYSTEM SPECIFICATIONS\*

Secommended Cut   38 kW   38' (10 mm) @ 230V   14' (6 mm) @ 120V   14' (6 mm) @ 230V   12' (12 mm)   11' (25 mm)   13'4' (45 mm)   2' (50 mm)   1' (25 mm)   10' (		Cutma	ster 42	Cı	utmaster	52	Cı	ıtmaster	82	Cu	tmaster <sup>2</sup>	102	Cutmaster 152		152
3/8" (10 mm) @ 230V   1/4" (6 mm) @ 120V   1/4" (6 mm)	Max Amperage Output	40 amps		60 amp	S		80 amps		100 am	ps		120 amps			
14" (6 mm) @ 120V   178" (22 2 mm) @ 230V   178" (22 2 mm) @ 230V   178" (23 0 mm)   172" (40 mm)   13/4" (45 mm)   22" (50 mm)   15" (25 mm)   120V   120	Kilowatt Output	3.8 kW		6.2 kW		9 kW		12 kW			15.4 kW				
1/2   1/2	Recommended Cut			1/2" (12	1/2" (12 mm)		3/4" (20 mm)		1" (25 mm)		1 1/4" (30 mm)				
1/4" (6 mm) @ 120V   1/2" (12 mm)   1/2" (13 mm)	Maximum Cut			1 1/8" (30 mm)		1 1/2" (40 mm)		1 3/4" (45 mm)		2" (50 mm)					
S0/60 Hz	Pierce Rating		,	1/2" (12	mm)		5/8" (15 mm)		3/4" (20 mm)		1" (25 mm)				
Duty Cycle (@ 40° C)	Input Voltage		ph,	50/60 Hz 400V, 3 ph, 50 Hz		50/60 Hz 400V, 3 ph, 50 Hz		50/60 Hz 400V, 3 ph, 50 Hz		50/60 Hz 400V, 3 ph, 50 Hz		lz			
120V   29A   230V   45A   24A   230V   72A   39A   230V   95A   45A   230V   118A   56A	Duty Cycle (@ 40° C)	40% @ 40A - -		60% @	50A		40% @ 80A 60% @ 65A		60% @ 100A 80% @ 80A						
H   9" (288 mm)   15" (381 mm)   15" (381 mm)   15" (381 mm)   12" (305 mm)   12" (305 mm)   12" (305 mm)   12" (305 mm)   30" (762 mm)   3	Amperage Draw	120V	29A	230V	45A	24A	230V	72A	39A	230V	95A	45A	230V	118A	56A
12   305 mm   30   (762 mm   30   (30	Work Cable	10' (3 m)		20' (6.1			20' (6.1m)		20' (6.1m)						
A Year Power Supply, 1 year Torch   1 year Torch	Dimensions W	7" (177 mm)		12" (30	5 mm)		12" (305 mm)		12" (305 mm)		12" (305 mm)				
1 year Torch   1 ye	Weight	26 lbs (11.8 l	kg)	43 lbs (	19.5 kg)		43 lbs (19.5 kg)		62 lbs (28.1 kg)		62 lbs (2	28.1 kg)			
Torch Configuration   SL40 w/ ATC,   SL60 w/ATC,   75° hand torch   75°	Warranty (Parts & Labor)														
SL40 w/ ATC, 75° hand torch   SL400 w/ ATC, 75° hand torch   SL400 w/ ATC, 75° hand torch   SL400 (Optional)	Certifications	IP-23C, CSA	A, NTRL/C	IP-23C	CSA, N	TRL/C	IP-23C, CSA, NTRL/C		IP-23C, CSA, NTRL/C		IP-23C, CSA, NTRL/C				
Automated &	Torch Configuration														
Mechanized Torch	Hand Torch (Supplied)		,		,										
Signature   Sign	Automated & Mechanized Torch	-		SL100 (	Optional	)	SL100 (Optional)		SL100 (Optional)		SL100 (Optional)				
Ordering Information by Torch         Please See Your ESAB Sales Representative for Specific System Configurations           6L40 - 15 ft (4.5 m) lead         1-4200 / 1-4200-7 (CSA)         -	Air Pressure	75 psi (5.2 b	ar)		,		70 psi (4.8 bar)		70 psi (4.8 bar)		70 psi (4	1.8 bar)			
by Torch   St.40 - 15 ft (4.5 m) lead   1-4200 / 1-4200-7 (CSA)   -   -   -   -   -	Flow	3.2 cfm (91 l	/m)	6.7 cfm	(190 l/m)	)	6.7 cfm	(190 l/m	)	7.5 cfm	(212 I/m)		7.5 cfm	(212 l/m)	)
SL60 - 20 ft (6.1 m) lead - 1-5130-V** 1-1130-V** SL60 - 50 ft (15.2 m) lead - 1-5131-V** 1-1131-V** SL100 - 20 ft (6.1 m) lead 1-1330-V** 1-1730-V**		Please See Your I			e Your E	SAB Sale	es Repre	sentative	e for Spe	cific Sys	tem Con	figuratio	ns		
SL60 - 50 ft (15.2 m) lead - 1-5131-V** 1-1131-V** SL100 - 20 ft (6.1 m) lead 1-1330-V** 1-1730-V**	SL40 - 15 ft (4.5 m) lead	1-4200 / 1-4	200-7 (CSA)		-		_		_				-		
SL100 - 20 ft (6.1 m) lead – – 1-1330-V** 1-1730-V**	SL60 - 20 ft (6.1 m) lead	-	-	-	I-5130-V	**	-	-1130-V	**		-			-	
·	SL60 - 50 ft (15.2 m) lead	-	-		1-5131-V	**		I-1131-V*	**		-			_	
SL100 - 50 ft (15.2 m) lead – – 1-1331-V** 1-1731-V**	SL100 - 20 ft (6.1 m) lead	-	-		-		-		1-1330-V**		1-1730-V**				
	SL100 - 50 ft (15.2 m) lead	-			_					1-1331-V**		1-1731-V**			

Systems include: power supply, hand torch, spare parts kit, input power cable (selected systems), work cable, and clamp \*Subject to change without notice

Note: All Cutmaster TRUE Series systems are designed to accept multi-voltage input; they can be ordered pre-configured for the voltage most likely to be used. The "-1" and "-2" configurations of catalog numbers listed are set up so that the machine is ordered in the configuration most often used by the individual customer, so that they do not need to add or change input power cable to operate upon receipt of the machine.

<sup>\*\*</sup>V (Pre-configured Voltage): 1 = 208/230V, 1 phase; 2 = 460V, 3 Phase; 5 = 600V, 3 Phase



# **AIRCUT™ 15C**

# LIGHT DUTY


Portable plasma cutting system with built-in air compressor. This unit comes standard with a built-in air compressor. Weighs only 29 lbs (13.2 kg), almost 50% lighter than the competition. Superior cutting capacity - 1/8" (3 mm) recommended cut, 3/16" (5 mm) maximum capability. Easy to use - 120V, 15 Amp plug standard. Plug it in anywhere! Faster cut speeds - 25% more cutting power provides 25% faster cut speeds than the competition.



# **DRAG-GUN® PLUS**

# **MEDIUM DUTY**

Portable plasma cutting system with built-in air compressor and humidity removal kit. 1/2" (12 mm) cut capacity. Maximum arc visibility for excellent operator control. Condenser minimizes (condenses) moisture content in the air supply!



capacity

Convenience and portability

 Maximum arc visibility for excellent operator control

 Condenser minimizes moisture content in the air supply!



#### **PERFORMANCE**

- Maximum Cut 3/16" (5 mm)
- Recommended Cut 1/8" (3 mm)
- Output Current 15 amps Fixed

# **DIMENSIONS**

6.5" W x 9.5" H x 18" D(165 mm x 241 mm x 457 mm)

#### **WEIGHT**

- 29 lbs (13.2 kg)
- Ship Weight 38 lbs (17.2 kg)

# **INPUT VOLTAGE**

■ 120V (± 10%), Single Phase, 60 Hz., leff: 12 amps

#### **DUTY CYCLE**

■ 35% @ 15A

#### **SPECIFICATIONS**

- Gas Type Air from Built-In Air Compressor
- Work Cable 19.5 ft (5.9 m)
- Input Cable 8.5 ft (2.6 m)
- Pilot CD Start
- Control Hand Torch Switch

#### **TORCH SPECIFICATIONS**

- PCH-10
- Hand 70°
- 20' (6.1 m) Leads

# **PERFORMANCE**

- Maximum Cut 1/2" (12 mm)
- Output Current 15-35 amps,
- Continuously Variable

# **DIMENSIONS**

■ 10.5" W x 11" H x 15.5" D (267 mm x 279 mm x 394 mm)

#### **WEIGHT**

- 76 lbs (34.5 kg)
- Ship Weight 85 lbs (38.6 kg)

### **INPUT VOLTAGE**

■ 230V (± 10%),Single Phase, 50/60 Hz.,leff: 18 amps

#### **DUTY CYCLE**

■ 35% @ 35 amps

# **SPECIFICATIONS**

- Gas Type Air from Built-InAir Compressor
- Work Cable 20 ft (6.1m)
- Input Cable 10 ft (3 m)
- Pilot CD Start
- Control Hand Torch Switch
- Panel Indicators AC, Over Temp, Air, Latch

# TORCH SPECIFICATIONS

- SureLok® PCH-42ER
- Hand 70°
- 20' (6.1 m) Leads

Part No.	Description
SYSTEM	
1-1110-1	PCH-10 70° Hand Torch 20 ft (6.1 m) Leads, 120V 1 Phase
REPLACEMENT 1	FORCH AND LEADS PACKAGES
2-1020	PCH-10 70° Torch / 20' (6.1 m) Leads
ACCESSORIES	
7-8910	Cutting Guide Kit
9-1260	20 ft (6.1 m) Leather Leads Cover
TORCH CONSUM	IABLES
9-6003	Shield Cup
9-6099	Tip
9-6007	Gas Distributor
9-6006	Electrode

Part No.	Description
SYSTEM	
1-3835-1F	SureLok® PCH-42ER 70® Torch / 20" (6.1m) Leads, 230V 50/60 Hz. 1 Phase (includes power supply, torch & leads, input power cable & plug, work cable & clamp, 3 tips, 2 electrodes, operators manual)
REPLACEMENT	TORCH AND LEADS PACKAGES
7-4220	SureLok® PCH-42ER 70° Torch / 20 ft (6.1m) Leads
<b>ACCESSORIES</b>	
7-7501	Radius/Roller Cutting Guide Kit
9-1260	20 ft (6.1m) Leather Leads Cover
TORCH CONSU	MABLES
9-6003	Shield Cup
9-6501	Tip - 40A
9-6542	SureLok Electrode - 40A
9-6507	Gas Distributor
9-8442	Torch Head

# SELECTING THE RIGHT TORCH PACKAGE FOR YOUR NEEDS...

STEP Torch and Leads Selection

- STEP 1 gives you all the information to select the right torch. - Manual Torch (pg 9)
- Mechanized & Automation Torch (pg 10)

Select: ■ Torch – Standard or Shielded

- Connection RPT (O2B) or ATC
- Lead Length
- ATC Lead Extensions (Optional, w/ ATC only)
- Remote Control Options (Mechanized or Automation only)

**Adapter Kit** Selection **STEP 2** (pg 12)

Select the appropriate Adapter Kit. If you selected a torch with the ATC connection, you will also need an ATC Receptacle Adapter shown in STEP 1 (pgs 9 or 10).

**Spare Parts** Selection **STEP 3** (pg. 13) Select spare parts or parts kit that best suits your needs.

STEP Torch and Lead Selection

# 1TORCHSL60

# LIGHT/MEDIUM DUTY TORCH (20-80 AMPS)

As a replacement (RPT°) torch, the 1Torch° has the ability to work on the majority of plasma power supplies on the market today. Its unique design allows the 1Torch the ability to work with high frequency, touch, CD, and moving parts (blow back) start systems.



	Part	No.	Description
Λ	75°	90°	<b>TORCH &amp; LEADS</b>
A	7-5200	7-5261	SL60, 20' (6.1 m)
	7-5201	7-5262	SL60, 50' (15.2 m)



	7-5204	7-5260	SL60, 20' (6.1 m)	
	7-5205	7-5260 1	SL60, 50' (15.2 m) 1	
ATC /	ADAPTER K		7/1/////	

	Part No.	Description	
	ATC RECEPTACLE ADAPT	ER	
	7-5207 <sup>3</sup> ATC Receptacle Co		
B	ATC LEAD EXTENSIONS: OPTIONAL (FOR ATC CONNECTIONS ONLY)		
	7-7544	15' (4.5 m) Lead Extension	
	7-7545	25' (7.6 m) Lead Extension	
	7-7552	50' (15.2 m) Lead Extension	

# 1TORCHSL100

# MEDIUM/HEAVY DUTY TORCH (20-120 AMPS)

Hand Torches offer ergonomic handles with easy-to-use trigger release that provides comfort during prolonged use. 75° and 90°heads offer operators a choice of positions.




	Part	No.	Description
A	75°	90°	<b>TORCH &amp; LEADS</b>
	7-5202	7-5264	SL100, 20' (6.1 m)
	7-5203	7-5265	SL100, 50' (15.2 m)

# ATC TORCH CONNECTION

7-7552







- Use 7-5260 with 7-7545 for a SL60 45' (13.7 m) Use 7-5263 with 7-7545 for a SL100 45 (13.7 m)
- This receptacle adapter is required for each power supply using an ATC torch connection. This is connected to the torch adapter kit specific to each power supply. Total lead length including torch and extension(s), should not exceed the maximum length specified by the power supply manufacturer.

50' (15.2 m) Lead Extension



# **1TORCH MECHANIZED SL100, AUTOMATION SL100SV**

MEDIUM/HEAVY DUTY TORCH (20-120 AMPS)

Only 34 consumable parts cover the full range of cutting and gouging up to 120 amps. Inventorying parts for a fleet of plasma units can be simplified using the 1Torch.





# **STANDARD**

SL100 Mechanized

STANDARD RPT (O2B) TORCH CONNECTION

	Part No.	Description
	SL100 MECHANIZEI (Fiberglass Tube w/Rack)	D TORCH & LEADS
A	7-5209	SL100, 180°, 25' (7.6 m)
	7-5210	SL100, 180°, 50 (15.2 m)
	Remote Interface Adapter 7	7-3452 included with torch.

# ATC TORCH CONNECTION



	Part No.		Description
	SL100 Mechanized Torch	<b>SL100SV</b> ® Automated Torch <sup>3</sup>	TORCH & LEADS (For Cutmaster Series Only, Does Not Work With Lead Extensions)
D	7-5213	-	SL100, 180°, 5' (1.5 m)
D	7-5214	_	SL100, 180°, 10' (3.0 m)
	7-5215	7-4001	SL100, 180°, 25' (7.6 m)
	-	7-4002	SL100, 180°, 35' (10.6 m)
	7-5216	7-4003	SL100, 180°, 50' (15.2 m)
	-	7-4004	SL100, 180°, 75' (22.8 m)
	-	7-4005	SL100, 180°, 100' (30.4 m)

# ATC ADAPTER KIT



	Part No.	Description
	ATC RECEP	PTACLE ADAPTER
	7-5207	ATC Receptacle Connector <sup>2</sup>
		EXTENSIONS <sup>3</sup> : OPTIONAL CONNECTIONS ONLY)
	7-7544	15' (4.5 m) Lead Extension
	7-7545	25' (7.6 m) Lead Extension
	7-7552	50' (15.2 m) Lead Extension
D	MECHANIZED REMOTE CONTROLS	
В	7-3474	ATC Remote Interface Kit - Provides an optional remote interface connection to allow the use of any remote control. Can be placed anywhere between the ATC Torch connection or Lead Extension & ATC Adapter
	7-3452	Remote Pendant Interface Kit - Interfaces into any torch adapter kit to allow the use of a Remote Pendant (7-3460) on any Mechanized torch system.
	7-3460	Remote Pendant Control
	9-8312	25' (7.6 m) CNC Remote Cable
	9-8313	50' (15.2 m) CNC Remote Cable

# SHIELDED\*

STANDARD RPT (O2B) TORCH CONNECTION

	Part No.	Description
	<b>SL100 MECHANIZE</b>	D TORCH & LEADS
Λ	(Fiberglass Tube w/Rack)	
A	7-5211	SL100, 180°, 25' (7.6 m)
	7-5212	SL100, 180°, 50 (15.2 m)
	Remote Interface Adapter	7-3452 included with torch.

# ATC TORCH CONNECTION



	Part No.	Description
	<b>SL100 MECHANIZE</b>	D TORCH & LEADS - SHIELDED
	(Fiberglass Tube w/Rack)	
B	7-5219	SL100 <sup>1</sup> , 180°, 5' (1.5 m)
	7-5220	SL100 1, 180°, 101 (3.0 m)
	7-5221	SL100 <sup>1</sup> , 180°, 25' (7.6 m)
	7-5222	SL100 <sup>1</sup> , 180°, 50 <sup>1</sup> (15.2 m)

# ATC ADAPTER KIT




	7-3472	ATC Receptacle Connector <sup>2</sup>	
	MECHANIZED REMOTE CONTROLS		
7-3452		Remote Pendant Interface Kit - Interfaces into any torch adapter kit to allow the use of a Remote Pendant (7- 3460) on any Mechanized torch system.	
	7-3460	Remote Pendant Control	
	9-8312	25' (7.6 m) CNC Remote Cable	
	9-8313	50' (15.2 m) CNC Remote Cable	

ATC RECEPTACLE ADAPTER

- 1 It is only recommended to install shielded torches onto a shielded ready system. Installation onto a non-shielded system may result in reduced performance. Installing a shielded torch on to a shielded system requires the shield connections to be terminated to a proper shield termination or earth ground point.
- 2 This receptacle adapter is required for each power supply using an ATC torch connection. This is connected to the torch adapter kit specific to each power supply. Total lead length including torch and extension(s), should not exceed the maximum length specified by the power supply manufacturer.
- 3 ATC Lead Extensions are for use on hand and mechanized torches only. Will not work with automated torches.

# **TORCH CONNECTION OPTIONS - REMOTE CONTROL**

The diagrams below show the different torch connections with remote connection options.

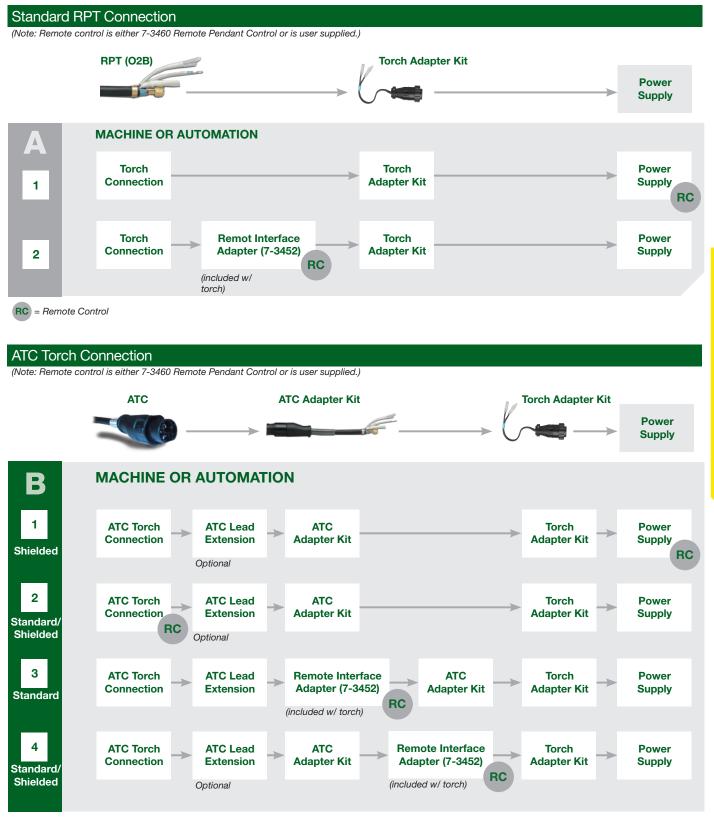

RC = Remote Control



# PLASMA TORCH ADAPTER KITS SELECTION

Listed below is the Adapter Kit selection charts for the Hand 1Torch® RPT® torch.



Manufacturer	Power Supply Model	Part No.
	PCM-SMi, 500i, 625i, PCS-43	7-3425
	PCS-53, 80, 90	7-3435
	ESP-100i	7-3426
ECAD®	PCM-750i, 875, 1000i, 1125	7-3429
ESAB°	Sidewinder 30,55,105	7-3434
	Powercut® 650	7-3464
	Powercut 875, 1125	7-3465
	Powercut 1250, 1500	7-3462
HARRIS®	System 50, 65 and 100	7-3439
HOBART®	Smoothcut II 35A, 60A, and 100A	7-3427
	Max® 40, HT® 40 (H/F Start) Max 70, 80, 100 (w/ & w/o Q.D.)	7-3430
	Max 42*, 43*, 40cs*, Powermax* 600*, 800*, 900* (w/ Q.D.)	7-3454
	Powermax 1100*	7-3455
HYPERTHERM®	Powermax 1000*, 1250*	7-3461
	Max 40cs* (w/o Q.D.)	7-3476
	Powermax 380*	7-3477
	Powermax 600* (w/o Q.D.)	7-3480
	Powermax 800*, 900* (w/o Q.D.)	7-3481
	Powermax 1650*	7-3483
	Powermax 350*	7-3484
	PCM-31, SMi, 32i/34i, VPi PCM-500i, 625i, PCS-80i	7-3425
L TEC°	PCM-50A, 70, 80, 52i/54i, 82i/84i ESP-100i, PCM-50, PCM-100 (Single Gas) PCM-50, P-MC-100 (Dual Gas)	7-3426
	PCS-40	7-3430
	PCM-750i, 1000i	7-3435
	PCM-101	7-3436

Manufacturer	Power Supply Model	Part No.
LINCOLN®	Procut 60	7-3431
	Plazcut 60†/Zipcut	7-3432
	Spectrum® 250D, 500, 750	7-3433
	Spectrum 700, 1000,1250,PLUS	7-3430
MILLER®	Spectrum 3080*	7-3456
WILLER	Spectrum 650*, 701*, 2050*	7-3457
	Spectrum 300*	7-3476
	Spectrum 375*	7-3477
	Spectrum 625*	7-3478
OTHERS	OTC®: D-5000 and D-7000 PTRON®: P-TRON 75 and 100 Daihen®: MRAT-70 Multiquip®: PCX50SS	7-3437
SMITH	Powerpro 55 and 75	7-3487
	PAK® 3XR, 5XT, 6XR, 7XR, 625XR, 750XR	7-3446
	PAK 8XR, 10XR, 1000XR, 1250XR, PakMaster® 75, 100	7-3434
	PakMaster 50XL/XLP, 75XL/XLP, 100XL/XLP Cutmaster® 50, 75, 80XL, 100	7-3447
THERMAL DYNAMICS	PakMaster 25, 38XL, EconoPAK° 25, Drag-Gun° 38, PAK 4Xi, 6Xi, PAK 2XT, Dynapak° 110	7-3443
	PakMaster 50 w/Smart Torch (Q.D)	7-3445
	EconoPAK 50	7-3449
	EconoPAK 100	7-3450
	PAK 5	7-3444
	PAK 10	7-3436


NOTES: Each Adapter Kit includes connection fitting, electrical connectors and installation instruction sheets for the selected power supply.

ESAB, L-TEC and Power-Cut are registered trademarks of ESAB AB; LINCOLN and Pro-Cut are registered trademarks of Lincoln Electric Co.; HYPERTHERM, Max and powermax are registered trademarks of Hypertherm, Inc.; MILLER and Spectrum are registered trademarks of Miller Electric Mfg. Co.; none of the afore mentioned registered trademarks are in any way affiliated with Thermal Dynamics or Victor Technologies; Thermal Dynamics, PAK, Cutmaster, PakMaster, EconoPAK, Dynapak and Drag-Gun are registered trademarks of Victor Technologies International, Inc.

<sup>\*</sup> Non-HF Systems.

<sup>†</sup> The Miller PlazCut machines with Serial Numbers beginning JE are not compatible with 1Torch® RPT Torches.

**STEP** 

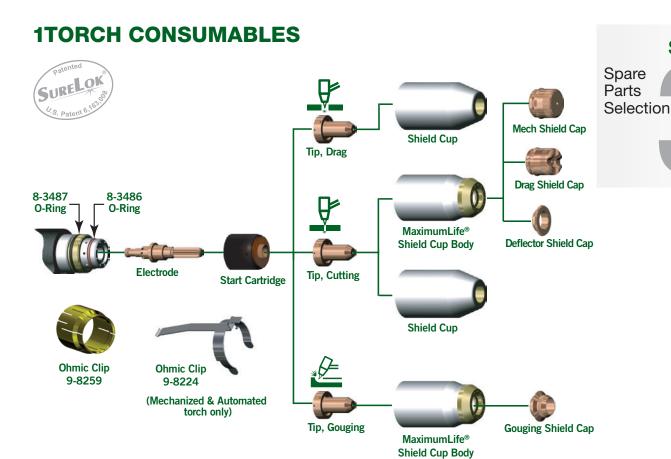

Description		Part No.
O-RINGS		
O-Ring		8-3487
O-Ring		8-3486
O-Ring Lubricant		8-4025
ELECTRODES		
Electrode		9-8215
START CARTRIDG	ES	
Start Cartridge		9-8213
Heavy Duty Start Car	tridge (Non HF Systems only)	9-8277
TIPS		
	Tip, 20A, Drag	9-8205
Drag	Tip, 30A, Drag	9-8206
Drag	Tip, 40A, Drag	9-8207
	Tip, 60A, Drag	9-8252
	Tip, 40A, Standoff	9-8208
	Tip, 50/55A, Standoff	9-8209
	Tip, 60A, Standoff	9-8210
Standoff	Tip, 70A, Standoff	9-8231
	Tip, 80A, Standoff	9-8211
	Tip, 90/100A, Standoff	9-8212
	Tip, 120A, Standoff	9-8253
	Tip, A, Gouging	9-8225
	Tip, B, Gouging	9-8226
Gouge	Tip, C, Gouging	9-8227
	Tip, D, Gouging	9-8228
	Tip, E, Gouging	9-8254

	Part No.		
<u> </u>			
Shield Cup			
mumLife®	9-8237		
Shield Cap, Drag, 40A	9-8244		
Shield Cap, Drag, 50-60A	9-8235		
Shield Cap, Drag, 70-100A	9-8236		
Shield Cap, Drag, 120A	9-8258		
Shield Cap, Mechanized, 40A	9-8245		
Shield Cap, Mechanized,	9-8238		
Shield Cap, Mechanized,	9-8239		
Shield Cap, Mechanized,	9-8256		
Shield Cap, Deflector	9-8243		
Shield Cap, Gouging	9-8241		
	9-8224		
orches	9-8259		
SPARE PARTS KITS			
Spare Parts Kit, 30 Amp			
Spare Parts Kit, 40 Amp			
Spare Parts Kit, 50/55 Amp			
Spare Parts Kit, 60 Amp			
Spare Parts Kit, 70 Amp			
)	5-2555		
Amp	5-2556		
	Shield Cap, Drag, 40A Shield Cap, Drag, 50-60A Shield Cap, Drag, 70-100A Shield Cap, Drag, 120A Shield Cap, Mechanized, 40A Shield Cap, Mechanized, 50-60A Shield Cap, Mechanized, 70-100A Shield Cap, Mechanized, 120A Shield Cap, Deflector Shield Cap, Gouging		

Note: All Spare Parts Kits include ten (10) Tips, five (5) Electrodes and one (1) Start Cartridge.

Int'l Customer Care: 1-940-381-1212 / FAX 1-940-483-8178



# **CUTTING GUIDE KIT (DELUXE)**

# **PART NO. 7-8910**

Cuts circles from 21/8" (54 mm) to 41½" (1054 mm) with proper cutting attachments. This kit includes easy add-on attachments to fit most Victor® Thermal Dynamics® torches for precise straight line, circle cutting and beveling. Includes Carrying Case, Radius/Roller Kit (7-7501), Circle Cutting Guide (7-3291), Magnetic Pivot, Suction Pivot.



# **CIRCLE CUTTING GUIDE KIT**

# **PART NO. 7-3291**


Cuts 2-1/8" (54 mm) to 27¾" (705 mm) circles (using magnetic attachment) when cutting or beveling is required. For use with most Victor Thermal Dynamics torches. Guide shown with optional pivot (7-3148).



# RADIUS / ROLLER CUTTING GUIDE KIT

#### PART NO. 7-7501

This easy-to-use guide cuts circles from 3" (76 mm) up to 28¾" (730 mm). Maintains a consistent height off the work piece whether





# STRAIGHT LINE CUTTING GUIDE

#### **PART NO. 7-8911**

Introducing a new cutting guide accessory suitable for all hand torches. This versatile, straight line cutter is for hand held systems and it cuts vertical, 90° or bevel cuts. Its consistent standoff improves cut quality & maximizes overall performance. Produces more efficient straight line cuts. Lightweight, minimum set up time, and no power required. Magnetic mounts ensure placement and ease of use. Optional suction plates available for non-magnetic applications (i.e. aluminum and stainless steel). The Cutting Guide Kit includes: 4 ft (1.2 m) standard rail Torch Holder and Bushing Heavy Duty Magnets (2 ea.) Slide Assembly Wheels and Fasteners. Optional 4 ft (1.2 m) extensions (9-7971) available.





# STANDOFF CUTTING GUIDES

#### **PART NO. 9-0090**

(Cutmaster 42)

The Standoff Cutting Guide is now available for the SL40™ torch, in addition to the SL60° and SL100° torches.

PART NO. 9-0090 SL40 Torch

PART NO. 9-8251 For use with 40A tips on the SL60/SL100 Torch

PART NO. 9-8281 For use with 60-100A tips on the SL60/SL100 Torch



# **CUTTING GUIDE BUSHING**

#### **PART NO. 7-2915**

Designed to fit the SL40 torch specific to the Cutmaster 42 system. This bushing accommodates the use of the SL40 torch with the cutting guides.



# **LEATHER LEAD COVERS**

PART NO. 9-1258 15 ft (4.6 m)

PART NO. 9-1260 20 ft (6.1 m)

PART NO. 9-1270 25 ft (7.6 m)

PART NO. 9-1280 50 ft (15.2 m)

These lead covers are suitable for both 1Torch\* and SureLok\* leads. Snaps make it easy to install. For wider torches, consider snapping two covers together width wise.



# **TRIGGER GUARD GUIDES**

1Torch (SL60 and SL100)

PART NO. 9-8420 Short Trigger Guard

These guards offer additional protection from accidental activation or damage to the torch switch.

# REMOTE PENDANT CONTROL

**PART NO. 7-3460** 

20 ft (6.1 m)

Remote Pendant Control for your mechanized application.



# HAND PENDANT EXTENSION

**PART NO. 7-7744** 25 ft (7.6 m)

# **ATC® LEAD EXTENSIONS**

**7-7544** 15 ft (4.6 m)

7-7545 25 ft (7.6 m)

7-7552 50 ft (15.2 m)

Available for any system using hand or mechanized 1Torch® with ATC Quick Disconnect. Leads Extensions enable you to customize your lead length to suit the cutting job.



# **AIR FILTER / AIR FILTER KITS**

For improved consumable parts life and overall performance, Thermal Dynamics recommends Air Filter Kits be used on all plasma cutting systems.

# SINGLE STAGE AIR FILTER KIT

#### **PART NO. 7-7507**

(Filter Body 9-7740, Hose 9-7742, Filter Element 9-7741)
For use with shop compressed air systems, this in-line filter will not allow moisture or water to pass through the filter element even if it

becomes completely saturated. This hi-tech filter element actually blocks the absorption of water to increase performance and improve consumable parts life.



# TWO STAGE AIR FILTER

# **PART NO. 9-9387**

(First Stage Element 9-1021, Second Stage Element 9-1022)
The Two Stage Air Filter will remove moisture and contaminants from the air stream when using compressed air. The filter is capable of filtering to at least 5 microns. The filter assembly is pre-assembled and need only be installed on the power supply.



# **MULTI-PURPOSE CART**

#### **PART NO. 7-8888**

Designed for most portable manual cutting systems such as the PakMaster\* or Cutmaster,\* or any similar sized systems.

This rugged steel cart has easy rolling 8" (203 mm) diameter wheels along with 3" (76 mm) front mounted casters. This cart also serves as an excellent showroom display stand.



# **WELDING GLOVES**

**PART NO. 9-1250** 



# PLASMA CUTTING TECHNIQUES DVD

**PART NO. 9-1253** 



# **AUTOMATION ACCESSORIES**

# **AUTOMATION INTERFACE KIT**

**PART NO. 9-8311** 

For Cutmaster TRUE<sup>TM</sup> Series (52, 82, 102, and 152) This kit adds a divided low volt output for height controls that can use 50:1 arc voltage. Required for the Thermal Dynamics® SC-11 height control.

## **CNC HARNESS CABLE**

9-9385

# CNC INTERFACE CABLE FOR "START/STOP" AND "OK TO MOVE" ONLY:

9-1008 25 ft (7.6 m)

9-1010 35 ft (10.6 m)

**9-1011** 50 ft (15.2 m)

# **PINION ASSEMBLY**

**PART NO. 7-2827** 1-3/8" (35 mm) Diameter





# **PAK® 200i**

# MANUAL AIR-PLASMA CUTTING & GOUGING SYSTEM

**200** amps of Cutting Power – This unit is capable of hand cutting at 200 amps with the ability to cut up to 2-3/4" (70 mm) on Mild Steel. At full output this unit will cut 10 ipm (254 mm/min) on 2" (51 mm) carbon steel.

100% Duty Cycle - This machine offers 100% duty cycle at full output.

**Dual Gas Capability** – The dual gas system ensures superior quality and performance on ferrous and non-ferrous materials. (Plasma Gas: Air, ArH<sub>2</sub> Secondary Gas: Air, N<sub>2</sub>)

**High Gouging Removal Rate** – With the ability to remove up to 25 lbs (11.3 kg) of carbon steel per hour.

**Tip Saver for Optimal Tip Life** – This ensures that any accidental contact between the tip and the work at high power levels will not damage the tip.

#### **PERFORMANCE**

- Output Current 35-200 amps
- Output Power 40 kW
- Recommended Cut 1-1/2" (40 mm)
- Max Cut 2 3/4" (70 mm)
- Pierce Rating 1 1/4" (32 mm)

#### **DIMENSIONS**

48" H x 27.5" W x 40.6" D (1219 x 698 x 1031 mm)

#### WEIGHT

490 lbs w/o torch (222 kg)Fully Assembled Power Supply

#### **INPUT VOLTS**

- 380-415V, 3 ph, 50/60 Hz
- 400V CE, 3 ph, 50/60 Hz
- 480V, 3 ph, 50/60 Hz

Contact Thermal Dynamics for additional information on 240V & 600V input voltage requirements.

### **DUTY CYCLE**

■ 100% @ 200 amps

#### **AMPERAGE DRAW**

- 60A @ 380V
- 57A @ 400V
- 47A @ 480V

#### **SPECFICATIONS**

- Plasma Gas Air, ArH<sub>2</sub>, N<sub>2</sub>
- Secondary Gas Air, N<sub>2</sub>

#### **TORCH**

■ PCH200 Hand/Machine

#### **WARRANTY**

- 2 Year parts & Labor Power Supply
- 1 Year Parts & Labor Torch

# APPLICATIONS INCLUDE:


- General fabrication of Carbon Steel, Stainless Steel and Aluminum
- Over the road transport trailers
- Railroad maintenance
- Vessel manufacturing
- Pipe beveling and fabrication
- Petroleum refineries
- Foundries
- Chemical plants
- Mining operations
- Ship building



# TORCH CONSUMABLE PARTS

Description	Part No.
SHIELD CUPS	
Shield Cup, Standard	32-1325
Crown Shield Cup (Manual Cutting)	32-1326
Shield Cup (Gouging)	32-1527
TIPS	
Tip, 200A	32-1323
Tip, 150A	32-1330
Tip, 70A	32-1321
Tip, 55A	32-1322
Tip, 35A	32-1320
Tip (0.110) Gouging	32-1512
Tip (0.125) Gouging	32-1513
Tip (0.156) Gouging	32-1514
Tip (0.171) Gouging	32-1515

Description	Part No.
GAS DISTRIBUTORS	
Gas Distributor, Cutting	32-1315
Gas Distributor, Gouging	32-1509
ELECTRODES	
Electrode, Air, Cutting	32-1310
Electrode, Multi-Gas Cutting	32-1311
Electrode, Air, Gouging	32-1504
Electrode, ArH <sub>2</sub> , Gouging	32-1505
OTHER	
Coolant Tube Extension, Gouging	32-1502
Wrench	20-0001
O-Ring Lubricant	8-4025
Parts Box	9-4173



# POWER SUPPLY & LEADS

Product Description		Part No	
POWER SUPPLY & LEADS	480V	400V	400V CE
PAK 200i - 70° Torch / 25' (7.6 m) Leads	1-2239	1-2245	1-2251
PAK 200i - 70° Torch / 50' (15.2 m ) Leads	1-2240	1-2246	1-2252
PAK 200i - 90° Torch / 25' (7.6 m ) Leads	1-2241	1-2247	1-2253
PAK 200i - 90° Torch / 50' (15.2 m) Leads	1-2242	1-2248	1-2254
PAK 200i - 180° Torch / 25' (7.6 m ) Leads	1-2243	1-2249	1-2255
PAK 200i - 180° Torch / 50' (15.2 m ) Leads	1-2244	1-2250	1-2256
All manual systems include Power Supply, Torch and Leads, Spare Parts Kit, 25' (7.6 m) Work Cable & Clamp, and Torch Coolant.			

# **TORCH & LEADS PACKAGES**

Description	Part No.
PCH-200 / 70° / 25' (7.6 m) Leads	2-0009
PCH-200 / 70° / 50' (15.2 m) Leads	2-0010
PCH-200 / 70° / 100' (30.5 m) Leads	2-0011
PCH-200 / 90° / 25' (7.6 m) Leads	2-0012
PCH-200 / 90° / 50' (15.2 m) Leads	2-0013
PCH-200 / 90° / 100' (30.5 m) Leads	2-0014
PCM-200 / 180° / 25' (7.6 m) Leads	2-0015
PCM-200 / 180° / 50' (15.2 m) Leads	2-0016
PCM-200 / 180° / 100' (30.5 m) Leads	2-0017

# **ACCESSORIES / OPTIONS**

Description	Part No.
Torch Guide / Circle Cutting Attachment	7-7505
Remote Pendant Control	7-3460
Wheel Kit	9-7378

**LIMITED WARRANTY:** ESAB warrants that its products will be free of defects in workmanship or material. Should any failure to conform to this warranty appear within the time period applicable to the ESAB products as stated below, ESAB shall, upon notification thereof and substantiation that the product has been stored, installed, operated, and maintained in accordance with ESAB's specifications, instructions, recommendations and recognized standard industry practice, and not subject to abuse, misuse, neglect, alteration, accident, improper care and/or maintenance including lack of lubrication and protection from the elements, use of non ESAB genuine parts including consumables; will correct such defects by suitable repair or replacement, at ESAB's sole option, of any components or parts of the product determined by ESAB to be defective.

# THIS WARRANTY IS EXCLUSIVE AND IS IN LIEU OF ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

**LIMITATION OF LIABILITY:** ESAB shall not under any circumstances be liable for special or consequential damages, such as, but not limited to, damage or loss of purchased or replacement goods, or claims of customers of distributor (hereinafter "Purchaser") for service interruption.

The remedies of the Purchaser set forth herein are exclusive and the liability of ESAB with respect to any contract, or anything done in connection therewith such as the performance or breach thereof, or from the manufacture, sale, delivery, resale, or use of any goods covered by or furnished by ESAB whether arising out of contract, negligence, strict tort, or under any warranty, or otherwise, shall not, except as expressly provided herein, exceed the price of the goods upon which such liability is based.

# THIS WARRANTY BECOMES INVALID IF REPLACEMENT PARTS OR ACCESSORIES ARE USED WHICH MAY IMPAIR THE SAFETY OR PERFORMANCE OF ANY ESAB PRODUCT.

#### THIS WARRANTY IS INVALID IF THE PRODUCT IS SOLD BY NON-AUTHORIZED PERSONS.

The warranty is effective for the time stated below beginning on the date that the authorized distributor delivers the products to the Purchaser. Notwithstanding the foregoing, in no event shall the warranty period extend more than the time stated plus 1 year from the date ESAB delivered the product to the authorized distributor.

#### **4 YEARS PARTS AND LABOR**

Cutmaster® TRUE™ (Power Source)

#### **2 YEARS PARTS AND LABOR**

Drag-Gun® Plus, PAK® 200i

# 1 YEAR PARTS AND LABOR UNLESS SPECIFIED

AirCut® 15C, CutSkill® units (Power Source), Stand Off Controls 1Torch®, SureLok®, XTR, XT / XT-301 and Maximizer® torches

# 180 DAYS PARTS AND LABOR UNLESS SPECIFIED

All Other "Torch and Leads" Packages

#### 90 DAYS PARTS / NO LABOR

Replacement Repair Parts

ESAB limited warranty shall not apply to: Consumable Parts for MIG, TIG, Plasma welding, Plasma cutting and Oxyfuel torches, O-rings, fuses, filters or other parts that fail due to normal wear.

- \* Warranty repairs or replacement claims under this limited warranty must be submitted by an authorized ESAB repair facility within thirty (30) days of the repair.
- \* No employee, agent, or representative of ESAB is authorized to change this warranty in any way or grant any other warranty, and ESAB shall not be bound by any such attempt. Correction of non-conformities, in the manner and time provided herein, constitutes fulfillment of ESAB's obligations to purchaser with respect to the product.
- \* This warranty is void, and seller bears no liability hereunder, if purchaser used replacement parts or accessories which, in ESAB's sole judgment, impaired the safety or performance of any ESAB product. Purchaser's rights under this warranty are void if the product is sold to purchaser by unauthorized persons.

esab.com

# ISO 9001 REGISTERED FIRM

The Quality System of ESAB at our Denton, Roanoke, West Lebanon and Hermosillo locations is registered to meet the requirements of ISO 9001

U.S. Customer Care: 800-426-1888 / FAX 800-535-0557 · Canada Customer Care: 905-827-4515 / FAX 800-588-1714
International Customer Care: 940-381-1212 / FAX 940-483-8178 · CIGWELD Customer Care: 1 300-654-674 / FAX 61-3-9474-7391

Form No. 65-1504 (10/15/15) © 2015 ESAB esab.com Printed in U.S.A.